



GDE

16 Plus | 16 Cyl








Robert Bosch Power Tools GmbH
70538 Stuttgart
Germany
www.bosch-pt.com
1 609 92A 33R (2013.11) PS / 2



BOSCH

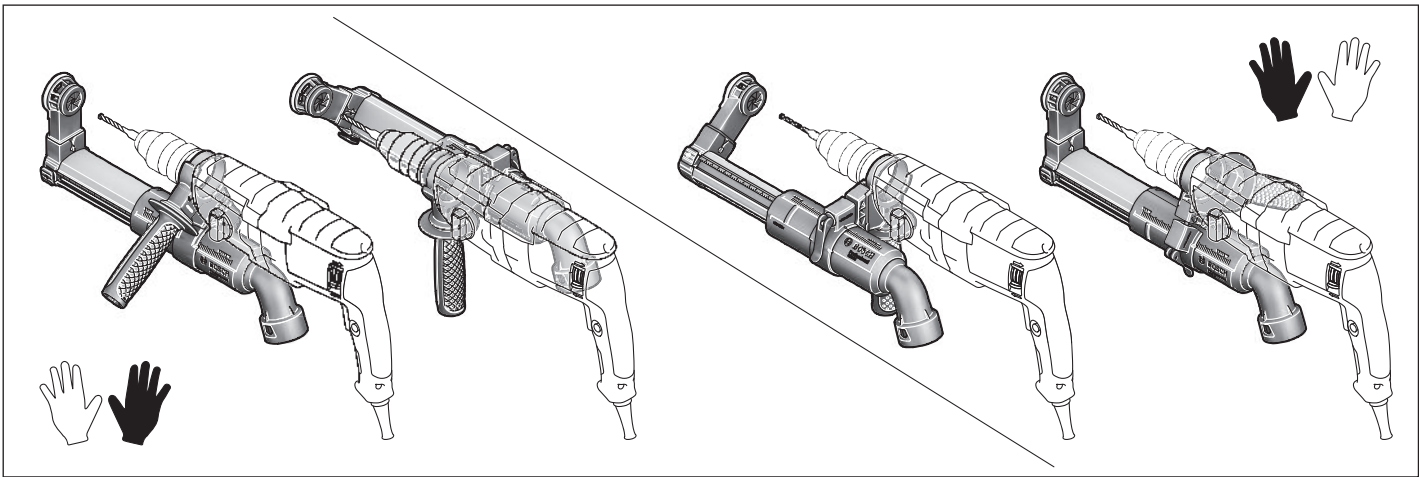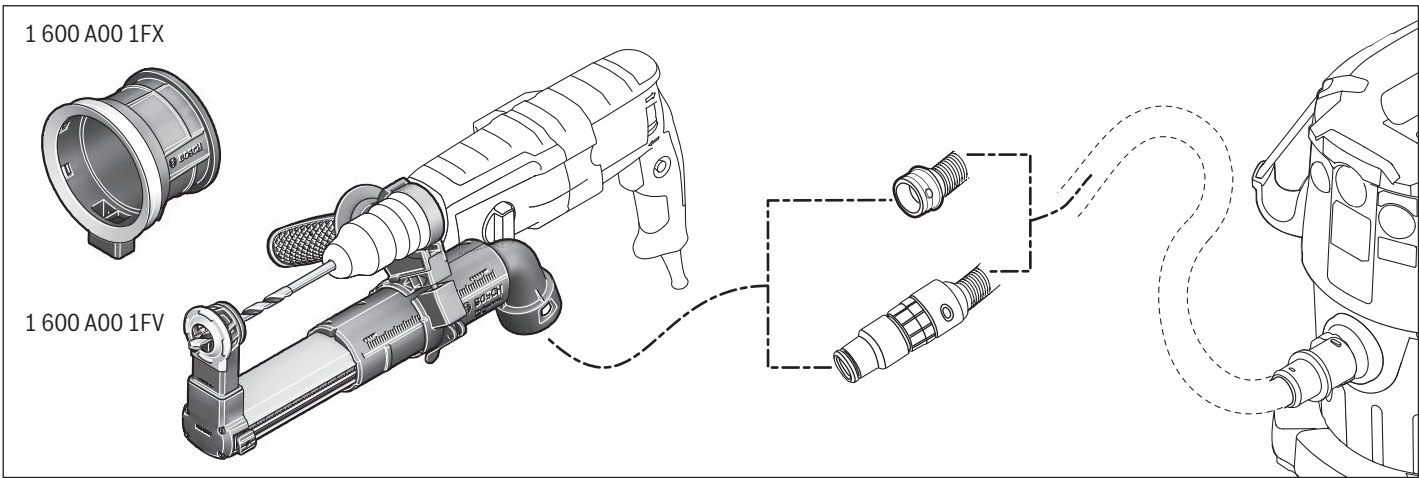

	mm	4-16
	mm	max. 82
	mm	50-230
	mm	120
1 600 A00 1FV	g	520
1 600 A00 1FX	g	115

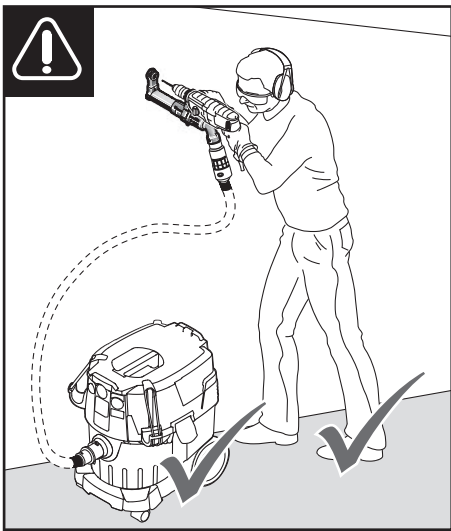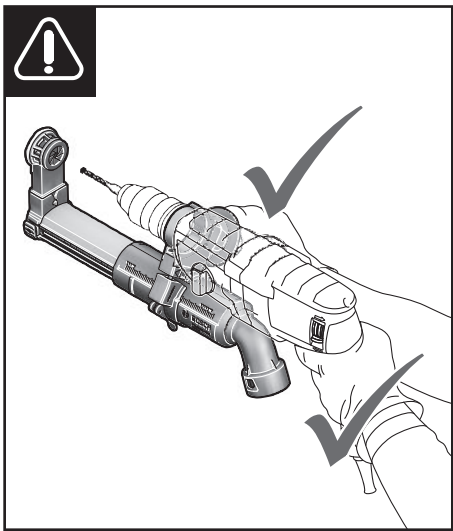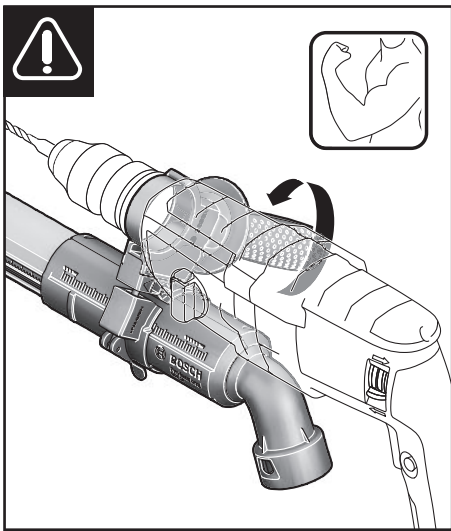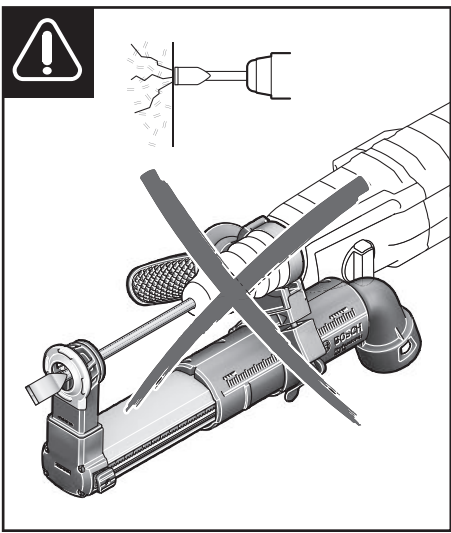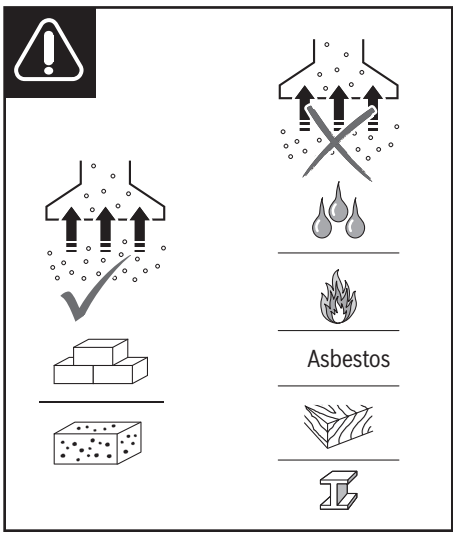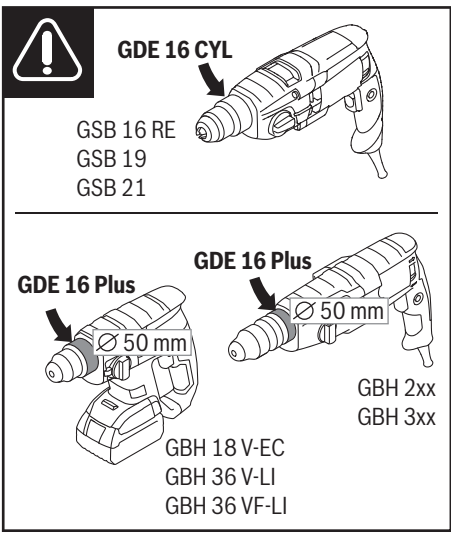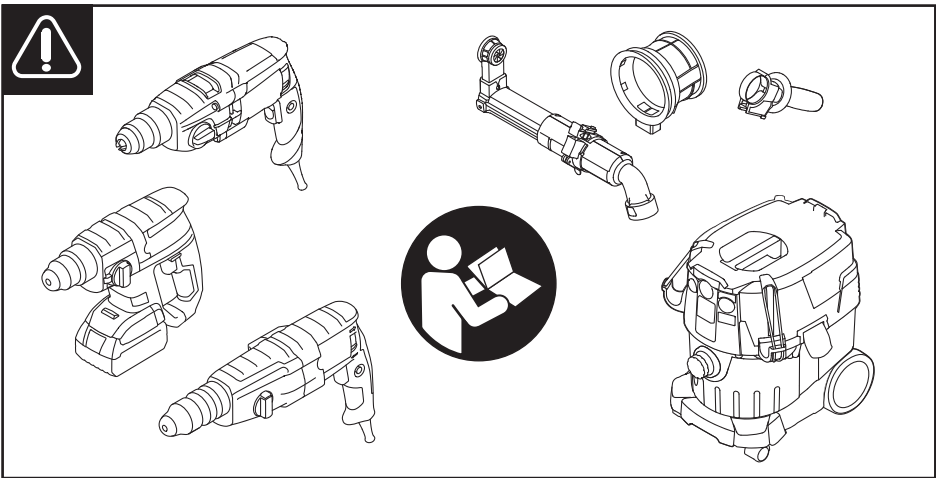

2 |

1

Diagram 1 shows the assembly of the GDE 16 Plus tool. It includes a side view of the tool with a drill bit and a top view showing the handle and trigger. The handle is labeled with a '1' and the trigger with a '2'. The drill bit is labeled with a '3'.

2

Diagram 2 shows the handle being attached to the tool. The handle is labeled with a '1' and the trigger with a '2'. The drill bit is labeled with a '3'. The handle is shown being moved from the side to the top of the tool.

3

Diagram 3 shows the handle being attached to the tool. The handle is labeled with a '1' and the trigger with a '2'. The drill bit is labeled with a '3'. The handle is shown being moved from the side to the top of the tool.

4

Diagram 4 shows the handle being attached to the tool. The handle is labeled with a '1' and the trigger with a '2'. The drill bit is labeled with a '3'. The handle is shown being moved from the side to the top of the tool.

5

Diagram 5 shows the handle being attached to the tool. The handle is labeled with a '1' and the trigger with a '2'. The drill bit is labeled with a '3'. The handle is shown being moved from the side to the top of the tool.

6

Diagram 6 shows the handle being attached to the tool. The handle is labeled with a '1' and the trigger with a '2'. The drill bit is labeled with a '3'. The handle is shown being moved from the side to the top of the tool.

7

Diagram 7 shows the handle being attached to the tool. The handle is labeled with a '1' and the trigger with a '2'. The drill bit is labeled with a '3'. The handle is shown being moved from the side to the top of the tool.

GDE 16 Plus 1 600 A00 15Z	GBH 2-28 DFV + GDE 16 Plus 0 611 267 205	Core Cutter Adapter 1 600 A00 17F	GDE 16 Cyl 1 600 A00 1FJ
1 600 A00 1FV 1 600 A00 1FX 1 602 025 079	3 611 B67 200 1 602 025 079 1 600 A00 1FV 2 608 438 692	1 600 A00 1FX	1 600 A00 1FV 1 600 A00 1FX 1 602 025 07A